

#### Avaya Solution & Interoperability Test Lab

# Application Notes for Jabra Direct and Evolve 75 UC Stereo Bluetooth/USB Headset with Avaya Equinox<sup>TM</sup> for Windows - Issue 1.0

#### Abstract

These Application Notes describe the configuration steps required to integrate Jabra Direct and Evolve 75 UC Stereo Bluetooth/USB headset with Avaya Equinox<sup>TM</sup> for Windows.

Readers should pay particular attention to the scope of testing as outlined in **Section 2.1**, as well as observations noted in **Section 2.2** to ensure that their own use cases are adequately covered by this scope and results.

Information in these Application Notes has been obtained through DevConnect compliance testing and additional technical discussions. Testing was conducted via the DevConnect Program at the Avaya Solution and Interoperability Test Lab.

#### 1. Introduction

These Application Notes describe the steps required to integrate Jabra Direct and Evolve 75 UC Stereo Bluetooth/USB (Evolve 75) headset with Avaya Equinox<sup>TM</sup> for Windows (Equinox). Direct is a PC application that enables Jabra USB devices to have call control over soft phone applications, including Evolve 75 and Equinox respectively. Evolve 75 headset has two kinds of connection to PC, one with a provided wired USB cable and another via Link 370 Bluetooth USB dongle. Link 370 also comes with the Evolve 75 headset.

# 2. General Test Approach and Test Results

The interoperability compliance test included feature and serviceability testing. The testing utilized two connection methods of Evolve 75 to Direct: USB cable and USB Bluetooth dongle to test with Avaya Equinox. The feature testing focused on placing calls to and from Equinox using Direct application and Evolve 75 headset, answering and ending calls using the call control button on the headset, and verifying two-way audio. The call types included calls between local extensions, and with the PSTN.

The serviceability testing focused on verifying the usability of the Jabra headset solution after restarting Equinox and reconnecting the Jabra headset to the PC.

DevConnect Compliance Testing is conducted jointly by Avaya and DevConnect members. The jointly-defined test plan focuses on exercising APIs and/or standards-based interfaces pertinent to the interoperability of the tested products and their functionalities. DevConnect Compliance Testing is not intended to substitute full product performance or feature testing performed by DevConnect members, nor is it to be construed as an endorsement by Avaya of the suitability or completeness of a DevConnect member's solution.

Avaya recommends our customers implement Avaya solutions using appropriate security and encryption capabilities enabled by our products. The testing referenced in these DevConnect Application Notes included the enablement of supported encryption capabilities in the Avaya products. Readers should consult the appropriate Avaya product documentation for further information regarding security and encryption capabilities supported by those Avaya products.

Support for these security and encryption capabilities in any non-Avaya solution component is the responsibility of each individual vendor. Readers should consult the appropriate vendor-supplied product documentation for more information regarding those products.

Avaya's formal testing and Declaration of Conformity is provided only on the headsets/handsets that carry the Avaya brand or logo. Avaya may conduct testing of non-Avaya headset/handset to determine interoperability with Avaya phones. However, Avaya does not conduct the testing of non-Avaya headsets/handsets for: Acoustic Pressure, Safety, Hearing Aid Compliance, EMC regulations, or any other tests to ensure conformity with safety, audio quality, long-term reliability or any regulation requirements. As a result, Avaya makes no representations whether a particular non-Avaya headset will work with Avaya's telephones or with a different generation of the same Avaya telephone.

Since there is no industry standard for handset interfaces, different manufacturers utilize different handset/headset interfaces with their telephones. Therefore, any claim made by a headset vendor that its product is compatible with Avaya telephones does not equate to a guarantee that the headset will provide adequate safety protection or audio quality.

#### 2.1. Interoperability Compliance Testing

All test cases were performed manually. The following features were verified:

- Placing calls to and from internal extensions to verify two-way audio.
- Placing calls to and from the PSTN and to Voicemail to verify two-way audio.
- Answering and ending calls using the call control button on the headset.
- Verifying incoming call notification on headset.
- Verifying call ended notification on headset.

For the serviceability testing, the headset was reconnected to Equinox and Equinox was restarted to verify proper operation of the headset.

#### 2.2. Test Results

All test cases were executed and passed.

## 2.3. Support

For support on this Jabra headset solution, contact Jabra Technical Support at:

■ Phone: (800) 697-8757

Website: http://www.jabra.com/NA-US/Support/pages/Default.aspx


• Email: JabraSupport.US@jabra.com.

# 3. Reference Configuration

**Figure 1** illustrates a sample configuration with an Avaya SIP-based network that includes the following Avaya products:

- Avaya Aura® Communication Manager running on a virtualized environment with a Avaya G450 Media Gateway.
- Avaya Aura® Session Manager connected to Communication Manager via a SIP trunk and acting as a Registrar/Proxy for SIP telephones.
- Avaya Aura® System Manager used to configure Session Manager.

In addition, the Direct application was installed on a PC that also has Equinox soft phone installed.

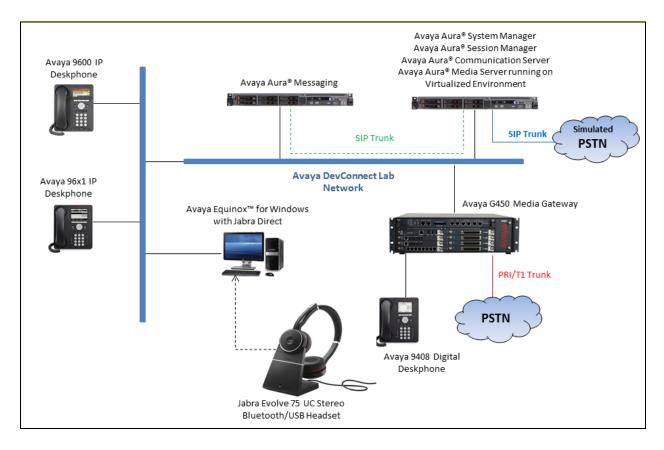

**Figure 1: Test Configuration Diagram** 

# 4. Equipment and Software Validated

The following equipment and software were used for the sample configuration provided:

Equipment/Software	Release/Version			
Avaya Aura® Communication Manager	7.1.0.532.0			
running on a virtual platform				
Avaya Aura® Session Manager running on	7.1.0.0.710028			
a virtual platform				
Avaya Aura® System Manager running on	7.1.0.0.1			
a virtual platform				
Avaya Aura® Messaging running on a	7.0 SP0			
virtual platform				
Avaya Aura® Media Server running on a	7.8.0.309			
virtual platform				
Avaya Equinox <sup>TM</sup> for Windows	3.1.1.18			
Avaya 9611G IP Deskphone	7.0.1.2 (SIP)			
	6.64 (H323)			
Avaya 9640 IP Deskphone	3.25A (H323)			
Avaya 9408 Digital Deskphone	V 2.0			
Jabra Direct	3.8.689			
Jabra Link 370 (USB Bluetooth dongle)	1.14.0			
Jabra Evolve 75 UC Stereo	1.12.0			

# 5. Configure Avaya Aura® Communication Manager

Configuration and verification operations on Communication Manager illustrated in this section were all performed using Avaya Site Administrator emulation mode. The information provided in this section describes the configuration of Communication Manager for this solution. It is implied a working system is already in place, including SIP trunks to Session Manager. For all other provisioning information such as initial installation and configuration, please refer to the product documentation in **Section 10**. The configuration described in this section can be summarized as follows:

- Verify System Capacity
- Define the Dial Plan

**Note:** Any settings not in **Bold** in the following screen shots may be left as default.

#### 5.1. Verify System Capacity

The license file installed on the system controls these attributes. If a required feature is not enabled or there is insufficient capacity, contact an authorized Avaya sales representative. Use the **display system-parameters customer-options** command to determine these values. On **Page 1**, verify that the **Maximum Off-PBX Telephones** allowed in the system is sufficient. One OPS station is required per Equinox.

```
display system-parameters customer-options
                                                                     1 of 10
                                                              Page
                                OPTIONAL FEATURES
    G3 Version: V16
                                                 Software Package: Enterprise
      Location: 2
                                                  System ID (SID): 1
       Platform: 28
                                                  Module ID (MID): 1
                                                              USED
                                Platform Maximum Ports: 65000 290
                                     Maximum Stations: 41000 44
                             Maximum XMOBILE Stations: 41000 0
                   Maximum Off-PBX Telephones - EC500: 41000 0
                    Maximum Off-PBX Telephones - OPS: 41000 14
                    Maximum Off-PBX Telephones - PBFMC: 41000 0
                    Maximum Off-PBX Telephones - PVFMC: 41000 0
                    Maximum Off-PBX Telephones - SCCAN: 41000 0
                         Maximum Survivable Processors: 313
        (NOTE: You must logoff & login to effect the permission changes.)
```

On **Page 2** of the **system-parameters customer-options form**, verify that the number of **Maximum Administered SIP Trunks** supported by the system is sufficient.

```
display system-parameters customer-options
                                                                      2 of
                                                                           10
                                                              Page
                                OPTIONAL FEATURES
IP PORT CAPACITIES
                                                              USED
                     Maximum Administered H.323 Trunks: 12000 16
          Maximum Concurrently Registered IP Stations: 18000 2
            Maximum Administered Remote Office Trunks: 12000 0
Maximum Concurrently Registered Remote Office Stations: 18000 0
             Maximum Concurrently Registered IP eCons: 414
 Max Concur Registered Unauthenticated H.323 Stations: 100
                        Maximum Video Capable Stations: 41000 1
                   Maximum Video Capable IP Softphones: 18000 4
                       Maximum Administered SIP Trunks: 24000 180
 Maximum Administered Ad-hoc Video Conferencing Ports: 24000 0
  Maximum Number of DS1 Boards with Echo Cancellation: 522
                             Maximum TN2501 VAL Boards: 128
                     Maximum Media Gateway VAL Sources: 250
                                                              0
                                                              0
          Maximum TN2602 Boards with 80 VoIP Channels: 128
          Maximum TN2602 Boards with 320 VoIP Channels: 128
                                                              0
  Maximum Number of Expanded Meet-me Conference Ports: 300
        (NOTE: You must logoff & login to effect the permission changes.)
```

#### 5.2. Define the Dial Plan

Use the **change dialplan analysis** command to define the dial plan used in the system. This includes all telephone extensions. In the sample configuration, telephone extensions are 4 digits long and begin with **33** and **34**.

change dialp	olan ar	nalysis					Page 1 of 12
				AN ANALYS	SIS TABLE all		ercent Full: 1
Dialed String		L Call th Type	Dialed String	Total Length		Dialed String	Total Call Length Type
33	4	ext					
34	4	ext					
*	3	fac					
#	3	fac					

# 6. Configure Avaya Aura® Session Manager

This section describes aspects of the Session Manager configuration required for Equinox to register. It is assumed that the Domains, Locations, SIP entities, Entity Links, Routing Policies, Dial Patterns and Application Sequences have been configured where appropriate for Communication Manager, Session Manager and Messaging.

Session Manager is managed via System Manager. Using a web browser, access https://<ip-addr of System Manager>/SMGR. In the Log On screen, enter appropriate User ID and Password and click the Log On button.



# 6.1. Check Avaya Aura® Session Manager Ports for SIP Endpoint Registration

Each Session Manager Entity must be configured so that the SIP Endpoint can register to it. From the web interface click **Routing**  $\rightarrow$  **SIP Entities** (not shown) and select the Session Manager entity used for registration. Make sure that TCP, UDP and TLS entries are present. During the compliance test, Equinox registered to Session Manager using TLS transport.



#### 6.2. Add a SIP User

A SIP user for Equinox must be added. Navigate to **User Management** → **Manage Users** → **New** (not shown) and configure the following in the **Identity** tab.


• Last Name and First Name Enter identifying names.

• **Login Name** Enter the extension number followed by the


domain, in this case 3407@bvwdev.com.

• Authentication Type Select Basic from the drop down list.


• Password and Confirm Password Enter and confirm a password.

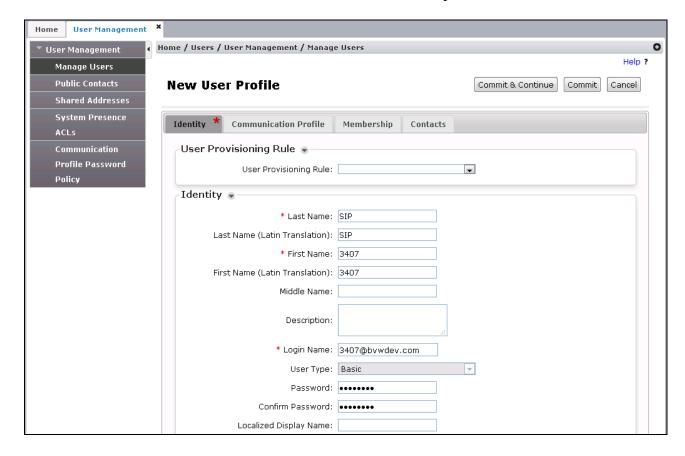


Click the **Communication Profile** tab and in the **Communication Profile Password** and **Confirm Password** fields, enter a numeric password. This will be used to register the Equinox during login.

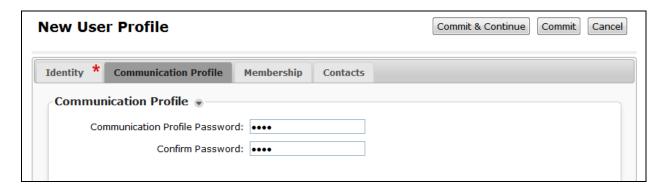

In the **Communication Address** section, for **Type** select **Avaya SIP** from the drop down list. In the **Fully Qualified Address** field enter the extension number as required and select the appropriate **Domain** from the drop down list. Click **Add** when done.

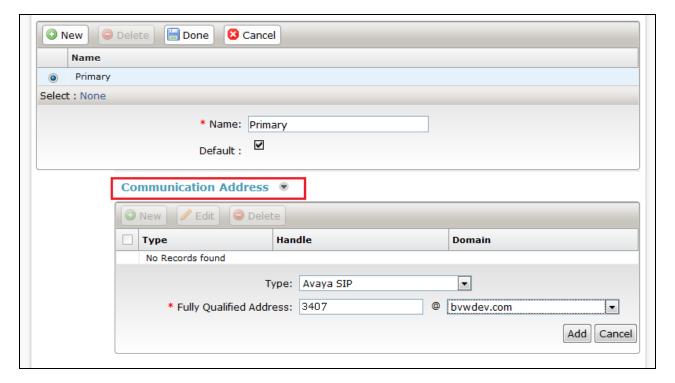

Place a tick in the **Session Manager Profile** check box and configure the **Primary Session Manager**, **Origination Sequence**, **Termination Sequence** and **Home Location**, from the respective drop down lists. The primary Session Manager used was **ASM70A**.

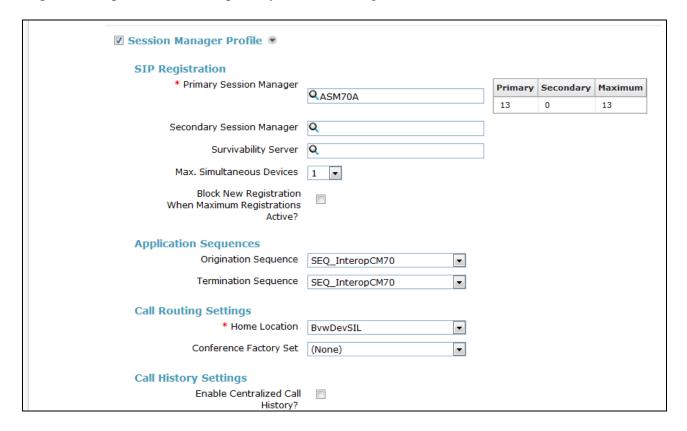

Place a tick in the **CM Endpoint Profile** check box and configure as follows:

• System Select the relevant Communication Manager SIP Entity from the

drop down list.


• **Profile Type** Select **Endpoint** from the drop down list.

• **Extension** Enter the required extension number, in this case **3407**.


• **Template** Select **9611SIP\_DEFAULT\_CM\_7\_0** from the drop down list. Note that the template can be any SIP template in this example the 9611SIP used.

• **Port** The "IP" is auto filled out by the system.

#### Click on **Endpoint Editor**.

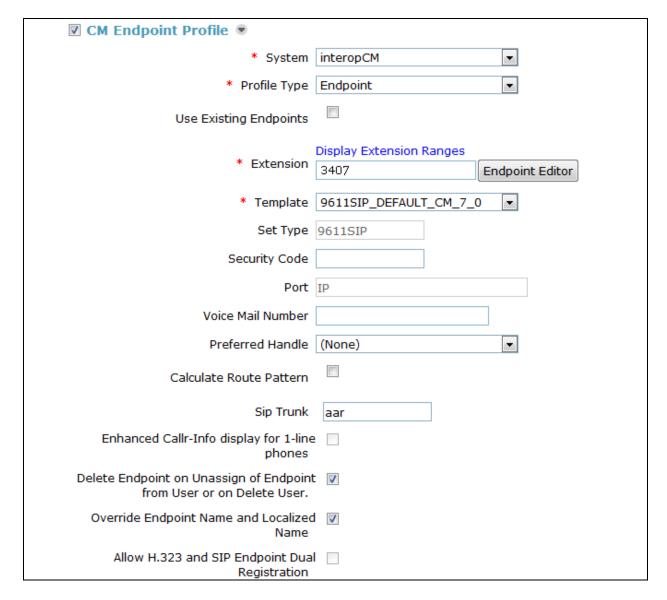


Click on the **Feature Options** tab, the screen shot below shows the Feature options that were used during compliance testing. Make sure the **IP SoftPhone** checkbox is selected.

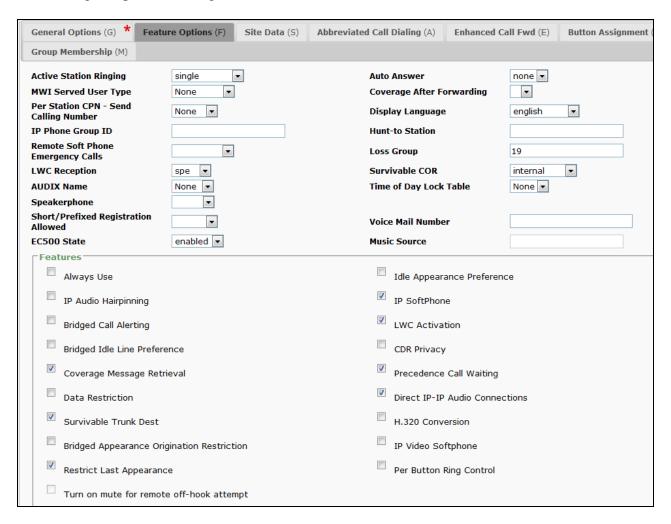


# 7. Configure Avaya Equinox™ for Windows

This section shows how to configure the Evolve 75 headset to use with Equinox.


From Equinox window, navigate to **Settings**  $\rightarrow$  **Accounts**  $\rightarrow$  **User Preferences**  $\rightarrow$  **Audio/Videos** and select *Headset Microphone (Jabra Evolve 75)* and *Headset Earphone (Jabra Evolve 75)* as shown below.

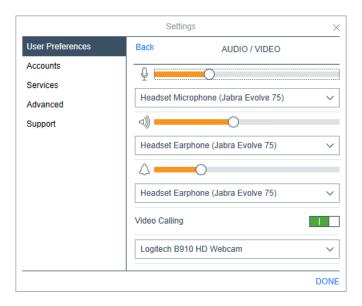


In case of Link 370 USB Bluetooth dongle being used, select the Link 370 values respectively as shown below.

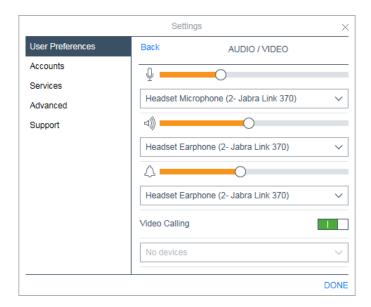

From Equinox window, navigate to **Settings**  $\rightarrow$  **Accounts**  $\rightarrow$  **Phone Services**; enter the SIP user and password as configured in **Section 6**.

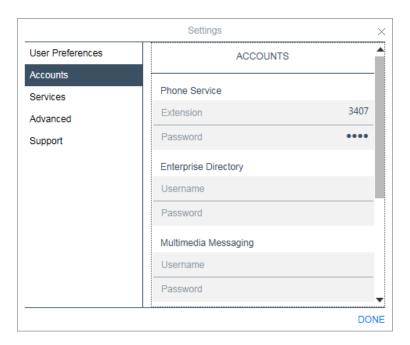

This window shows Equinox successfully registers to Session Manager.

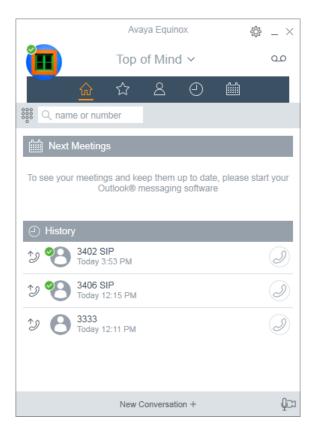


# 8. Configure Jabra Direct


Direct is PC software that can be downloaded from Jabra website at <a href="http://www.jabra.ca/software-and-services/jabra-direct">http://www.jabra.ca/software-and-services/jabra-direct</a>. Direct enables Evolve 75 to have call control over Equinox. This section assumes that Direct is already installed and updated to the latest version.

Direct automatically detects Evolve 75 and the connection method to the PC.

The picture below shows the **Device** tab in the Direct dashboard having the Evolve 75 UC headset connected to the PC via USB Bluetooth dongle, it displays "Device ready for use" with "Avaya Equinox" in **Ready** state.

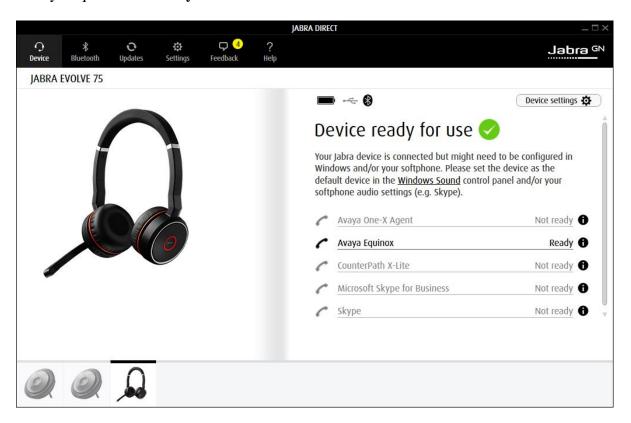

The **Bluetooth** tab displays the Link 370 USB dongle that is paired with Evolve 75 headset.

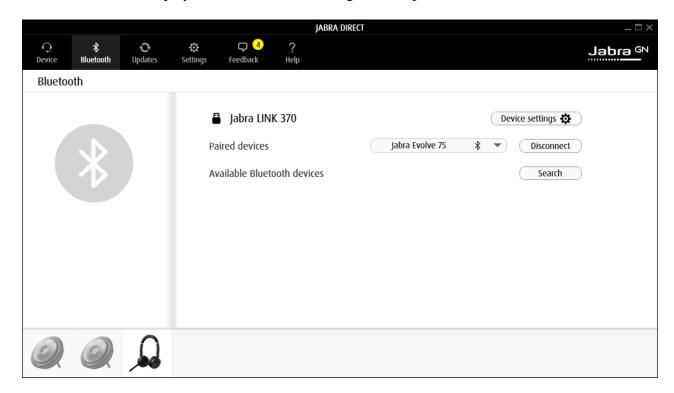

# 9. Verification Steps

This section verifies that Jabra Direct and Evolve 75 UC Bluetooth/USB headset has been successfully integrated Avaya Equinox<sup>TM</sup> for Windows.

- 1. Verify that the Jabra Evolve 75 headset has been successfully installed and is ready for use with Equinox.
- 2. Once the Jabra Evolve 75 headset is selected in Equinox, verify that incoming and outgoing calls can be established with two-way audio to the headset.
- 3. Verify that Jabra Evolve 75 headset is able to remotely call functions from the headset such as mute/un-mute, hold/un-hold and disconnect the call.

## 10. Conclusion

These Application Notes describe the configuration steps required to integrate Jabra Direct and Evolve 75 UC Bluetooth/USB headset with Avaya Equinox<sup>TM</sup> for Windows. All test cases were completed successfully; refer to **Section 2.2** for details.

#### 11. Additional References

This section references documentation relevant to these Application Notes. The Avaya product documentation is available at <a href="http://support.avaya.com">http://support.avaya.com</a> where the following documents can be obtained.

- [1] Administering Avaya Aura® Communication Manager, Release 7.1, May 2017, Document Number 03-300509, Issue 1.
- [2] Avaya Aura® Communication Manager Feature Description and Implementation, Release 7.1, May 2017, Document Number 555-245-205, Issue 1.
- [3] Administering Avaya Aura® Session Manager, Release 7.1, May 2017
- [4] Administering Avaya Aura® System Manager, Release 7.1, May 2017
- [5] Planning for and Administering Avaya Equinox<sup>TM</sup> for Android, iOS, Mac, and Windows, Release 3.1, Issue 3, March 2017

The Jabra Evolve 75 Headset documentation is available at <a href="https://www.jabra.com/supportpages/jabra-evolve-75#/#7599-832-109">https://www.jabra.com/supportpages/jabra-evolve-75#/#7599-832-109</a>

[1] Jabra Evolve 75 User Manual

#### ©2017 Avaya Inc. All Rights Reserved.

Avaya and the Avaya Logo are trademarks of Avaya Inc. All trademarks identified by ® and TM are registered trademarks or trademarks, respectively, of Avaya Inc. All other trademarks are the property of their respective owners. The information provided in these Application Notes is subject to change without notice. The configurations, technical data, and recommendations provided in these Application Notes are believed to be accurate and dependable, but are presented without express or implied warranty. Users are responsible for their application of any products specified in these Application Notes.

Please e-mail any questions or comments pertaining to these Application Notes along with the full title name and filename, located in the lower right corner, directly to the Avaya DevConnect Program at devconnect@avaya.com.